

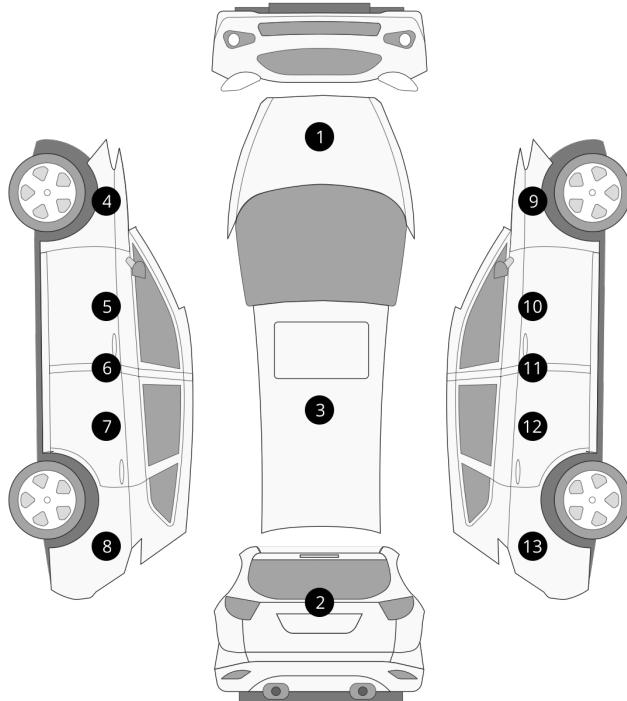
Grading Report

General Information

Date & Time: 14, Jan, 2026 10:24

Make	Toyota	Model	Fortuner
YOM	2022	Odo Meter Reading	52,789
Registration No.	NFL1711	Chassis No.	MHFAA8GS7N0774703
CC	2.8	Transmission	A/T
Fuel Type	Diesel	Type of Body	SUV
Colour	White		

Body / Panel Condition



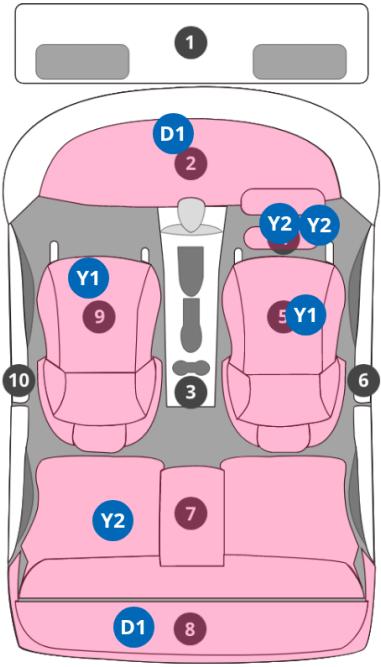
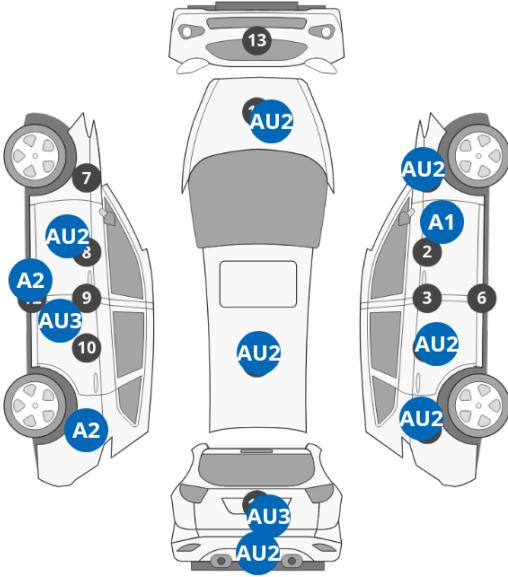
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	128.6	129	125	132
2	Boot Lid	151.0	187	133	133
3	Roof	130.2	131	137	141/112
4	Left Front Fender	129.3	141	119	128
5	Left Front Door	129.3	128	129	131
6	Center Panel Left				
7	Left Rear Door	119.6	120	125	114
8	Left Back Panel	127.0	133	122	126
9	Right Front Fender	131.3	155	111	128
10	Right Front Door	134.0	133	131	138
11	Center Panel Right				
12	Right Rear Door	132.0	140	118	138
13	Right Back Panel	134.3	137	124	142

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation :	B	Exterior Evaluation :	C
			
a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain			A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Seat - Grime - Minimal / (R) Front Seat - Grime - Minimal / (L) Front Floor Mat - Grime - Small / (R) Front Floor Mat - Grime - Small / Dashboard - Worked - Minimal / Rear Seat - Grime - Small / Trunk Room - Worked - Minimal			Remarks (L) Front Door, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Front Fender, Molding - Scratch & Dent - Small / Bonnet, Headlight - Scratch & Dent - Small / Roof - Scratch & Dent - Small
Frame Evaluation :	A	Functional Evaluation :	B
Remarks Defects not found			Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes

with LTO plate, with tools & jack reverse camera,with manual & warranty,no spare key,scratches on taillight and headlight.